

3D Adjustable Concealed Hinge MODEL NO. KCH6080

NOTE:

1.For indoor use only.not suitable for areas where it can be

direct contact with water.

2.Please check with manufacturer in advanced if use with a

door closer in order to make sure correct use


The door is possible could not close if the door is deformed

Need to check the screw at regular time to make sure it is

HINGE PARTS

COMPONENT PARTS

*Cover 8 pcs(door side x 4, frame side x 4)
*Screw (5x30) 8 pcs
*Allen wrench S4 1 pc *Concealed Hinge 2 pcs

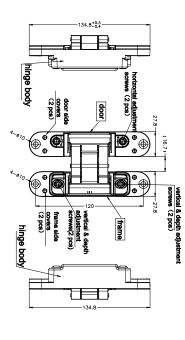


ADJUSTMENT

Depth	Horizontal	Vertical	
±1mm	-2mm,+4mm	±2mm	

ROUTING DRAWING

NOTE: The edge of door and frame need to be applied with C1 or R1 processing (refer to "A"in the drawing) door side routing drawing for




routing drawing for frame side

-28.5

a.HINGE DETAIL

INSTALLATION STEP:

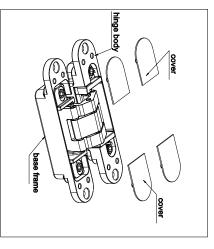


and frame.

2.Do not open/close with excessive force,or door may fall down. NOTE:
1.Make sure the hinge body is installed in correct position on door Install door side parts into door cutout position.
 Refeir to figure b temporarily hang the door by inserting both upper and lower frame parts into the frame cutout position at the same time.
 Make sure all screws are fixed after installation.

b.INSTALLATION

ADJUSTMENT STEP:

1.Vertical adjustment

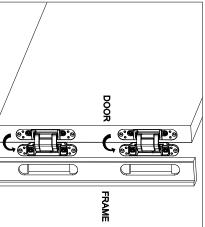

NOTE:

1.Recommended fastening force for vertical and depth adjustment is 3N.m(30.6kgf.cm).

 2.To prevent door falling.do not remove vertical adjustment screws.

2.Depth adjustment Locsen vertical & depth adjustment screw one turn with allen wrench to adjust. Then tighten screws once the door in proper position. Loosen vertical & depth adjustment screw one turn with allen key to adjust. Then tighten screws once the door in proper height.

3.Hortzontal adjustment
Turn the horizontal adjustment screw in clockwise direction to widen the gap
between door and frame.To narrow the gap,turn the screw in counter clockwise
direction.

 Gently turn horizontal adjustment screws for upper and lower hinge at
the same time.do not force turning of screws.
 Do not loosen the horizontal adjustment screws in clockwise direction NOTE:


over than 3mm,or door may fall

Finally,install all covers.

NOTE:

Do not handle the covers with excessive force or they may break

C.ADJUSTMENT (direction shows when door is in closing situation)

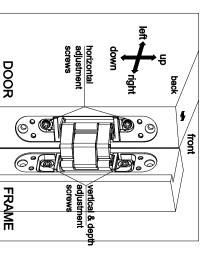

Selection Chart

DH (mm)					Š	X 2	
3000	2800	2600	2400	2200	2100	КСН6080	
4	4	З	3	3	2	800	
4	4	ω	3	З	2	850	
4	4	4	4	ω	2	900	_
4	4	4	4	3	3	950	DW (mm)
4	4	4	4	3	3	1000	
4	4	4	4	3	3	1050	
4	4	4	4	3	3	1100	
60				Weight (kg)	Max. Door		

door height<2.2m door width>1m

Number of hinges

DH (mm)						Š	KCH
3000	2800	2600	2400	2200	2100	KCH6080	
4	4	3	3	3	3	800	
4	4	3	3	3	3	850	
4	4	4	4	3	3	900	
4	4	4	4	4	4	950	DW (mm)
4	4	4	4	4	4	1000)
4	4	4	4	4	4	1050	
4	4	4	4	4	4	1100	
70				80	Weight (kg)	Max. Door	


Number of hinges

Installation Position


Over-width Door

middle hinge 350mm

top hinge 250mm

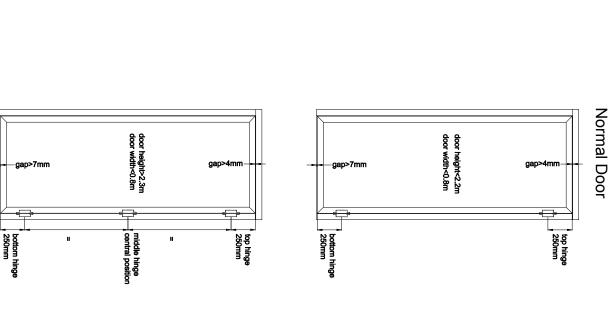

bottom hinge 250mm

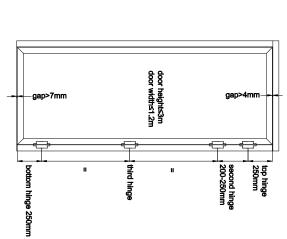

Over-height & width Door

Over-height Door